

REPORT

GENERAL INFORMATION

Report Name

Lanos

Read out date

2025-05-30 14:23:23

Date of editing

2025-06-04 10:50:17

Serial number

10373 PROFESSIONAL

Unit of measure

µm


VEHICLE DATA

Type	SEDAN
Make	3a3
Model	Lanos
Engine capacity [ccm]	1498
Power [kW]	62
VIN	Y6DTF69Y0B0267799
Fuel Type	Gas
Year of production	2011


MEASUREMENTS

"-" means measurement skip, "∞" means measurement out of range


PAS: general interpretation, body

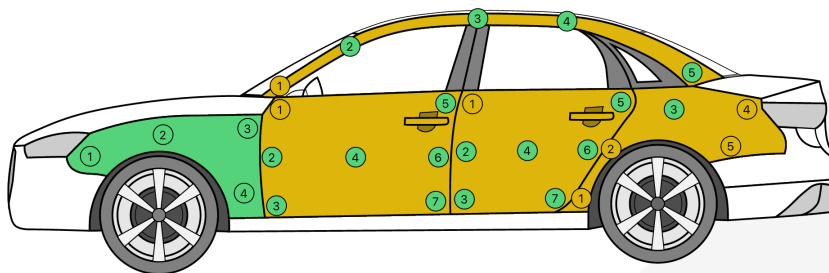


LEFT SIDE											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
left front fender/ bumper	Fe+Zn	143	161	152	161	143	160	143	-	-	-
left front door	Fe	132	193	149	193	143	144	132	149	136	149
left rear door	Fe	133	214	154	214	145	142	133	147	142	158
left pillar	Fe+Zn	130	217	154	217	131	150	130	143	-	-
left rear fender/ bumper	Fe+Zn	155	197	176	169	181	155	180	197	-	-

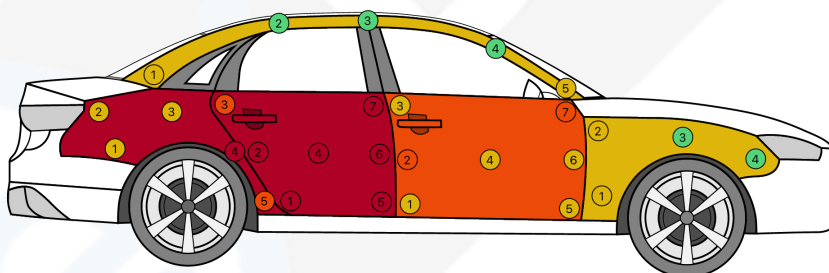

RIGHT SIDE											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
right front fender/ bumper	Fe	144	170	157	170	167	144	146	-	-	-
right front door	Fe+Zn	213	313	263	248	308	289	213	220	251	313
right rear door	Fe	451	1753	1065	1282	1197	451	572	1583	1753	614
right pillar	Fe+Zn	142	211	169	189	156	142	145	211	-	-
right rear fender/ bumper	Fe+Zn	206	518	324	259	206	233	518	405	-	-

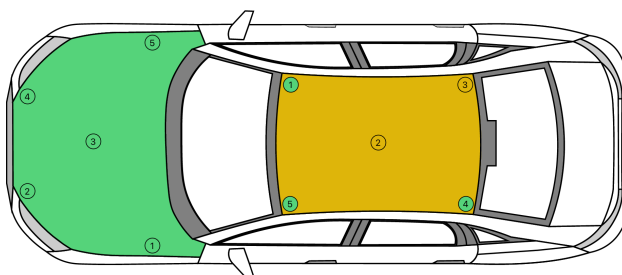


TOP											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
hood/bonnet	Fe	139	162	153	152	139	162	157	155	-	-
roof	Fe	147	205	168	161	205	171	154	147	-	-

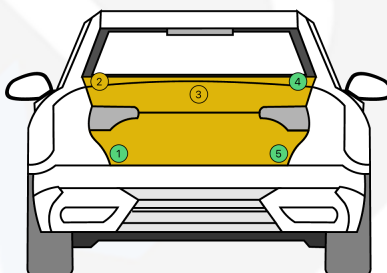

BACK											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
trunk/boot	Fe	152	198	170	152	198	170	165	164	-	-

Legend

- Disabled
- Paint layer is too thin
- Paint layer is original
- Second layer of paint
- A thin layer of putty
- A thick layer of putty

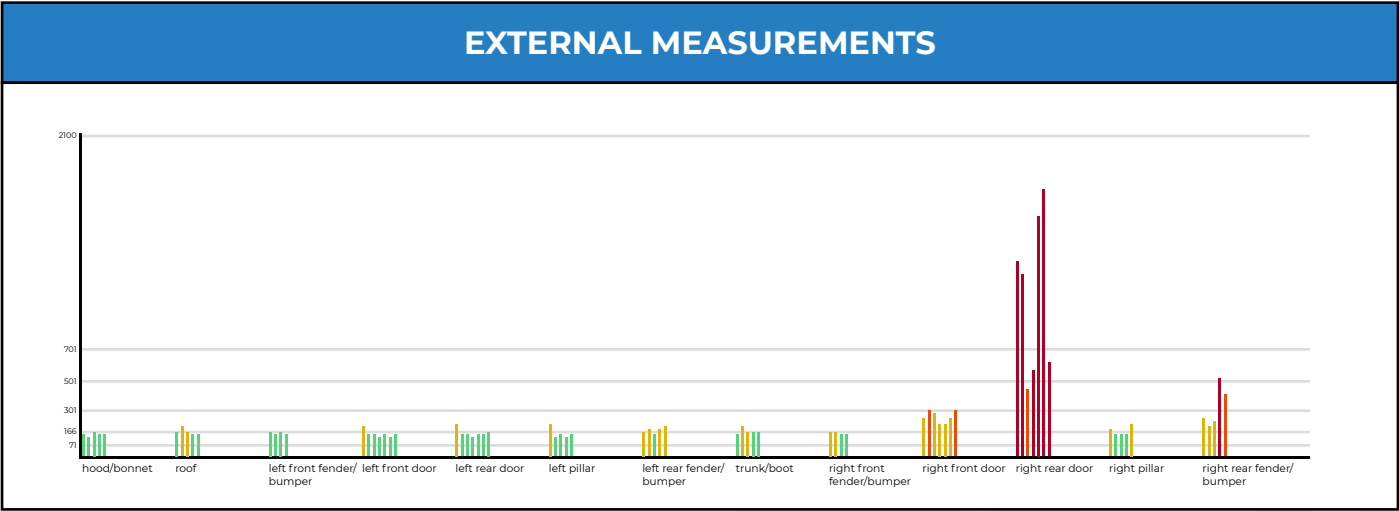

SYMMETRIC MEASUREMENTS

EXTERNAL MEASUREMENTS														
left front fender/ bumper	1. 161	2. 143	3. 160	4. 143	-	-	-	-	-	-	-	-	-	-
right front fender/ bumper	4. 146	3. 144	2. 167	1. 170	-	-	-	-	-	-	-	-	-	-
DIFFERENCE	15	1	7	27										
left front door	1. 193	2. 143	3. 144	4. 132	5. 149	6. 136	7. 149	-	-	-	-	-	-	-
right front door	7. 313	6. 251	5. 220	4. 213	3. 289	2. 308	1. 248	-	-	-	-	-	-	-
DIFFERENCE	120	108	76	81	140	172	99							
left rear door	1. 214	2. 145	3. 142	4. 133	5. 147	6. 142	7. 158	-	-	-	-	-	-	-
right rear door	7. 614	6. 1753	5. 1583	4. 572	3. 451	2. 1197	1. 1282	-	-	-	-	-	-	-
DIFFERENCE	400	1608	1441	439	304	1055	1124							
left pillar	1. 217	2. 131	3. 150	4. 130	5. 143	-	-	-	-	-	-	-	-	-
right pillar	5. 211	4. 145	3. 142	2. 156	1. 189	-	-	-	-	-	-	-	-	-
DIFFERENCE	6	14	8	26	46									
left rear fender/ bumper	1. 169	2. 181	3. 155	4. 180	5. 197	-	-	-	-	-	-	-	-	-
right rear fender/ bumper	5. 405	4. 518	3. 233	2. 206	1. 259	-	-	-	-	-	-	-	-	-
DIFFERENCE	236	337	78	26	62									