

REPORT

GENERAL INFORMATION

Report Name

Mercedes

Read out date

2025-03-21 11:42:47

Date of editing

2025-03-25 14:20:14

Serial number

10373 PROFESSIONAL

Unit of measure

µm


VEHICLE DATA

Type	SEDAN
Make	Mercedes
Model	S-class
Engine capacity [ccm]	4996
Power [kW]	225
VIN	WDB2201751A051246
Fuel Type	Gas
Year of production	1999


MEASUREMENTS

"-" means measurement skip, "∞" means measurement out of range


PAS: general interpretation, body

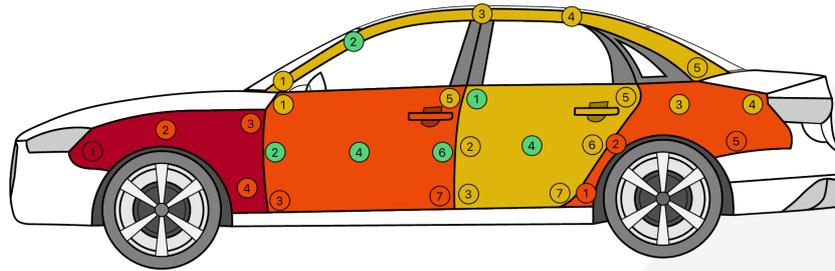


LEFT SIDE											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
left front fender/ bumper	Fe	331	687	457	687	387	422	331	-	-	-
left front door	Fe+Zn	139	336	206	189	155	308	139	166	152	336
left rear door	Fe	155	252	195	155	188	252	155	181	199	236
left pillar	Fe	142	202	177	194	142	174	171	202	-	-
left rear fender/ bumper	Fe	242	464	358	408	393	242	283	464	-	-

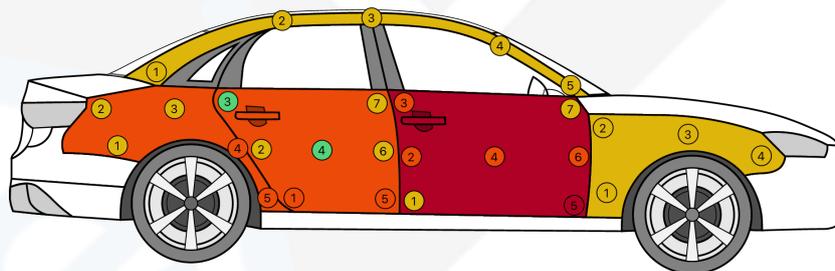

RIGHT SIDE											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
right front fender/ bumper	Fe+Zn	223	240	232	223	234	230	240	-	-	-
right front door	Fe+Zn	242	522	366	283	465	335	306	522	409	242
right rear door	Fe	151	374	229	374	183	164	151	322	208	201
right pillar	Fe	172	261	197	172	177	198	175	261	-	-
right rear fender/ bumper	Fe+Zn	173	342	258	277	176	173	322	342	-	-

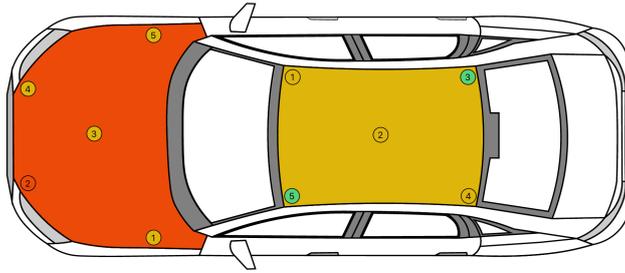

TOP											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
hood/bonnet	Al	172	331	217	189	331	194	199	172	-	-
roof	Fe	156	235	191	203	235	159	201	156	-	-

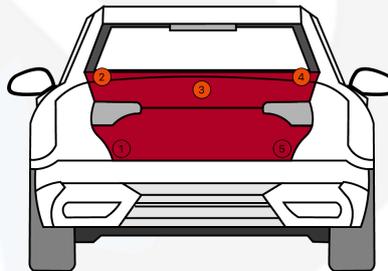


BACK											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
trunk/boot	Fe+Zn	379	585	483	585	379	440	441	569	-	-

Legend

- Disabled
- Paint layer is too thin
- Paint layer is original
- Second layer of paint
- A thin layer of putty
- A thick layer of putty

CHARTS

EXTERNAL MEASUREMENTS

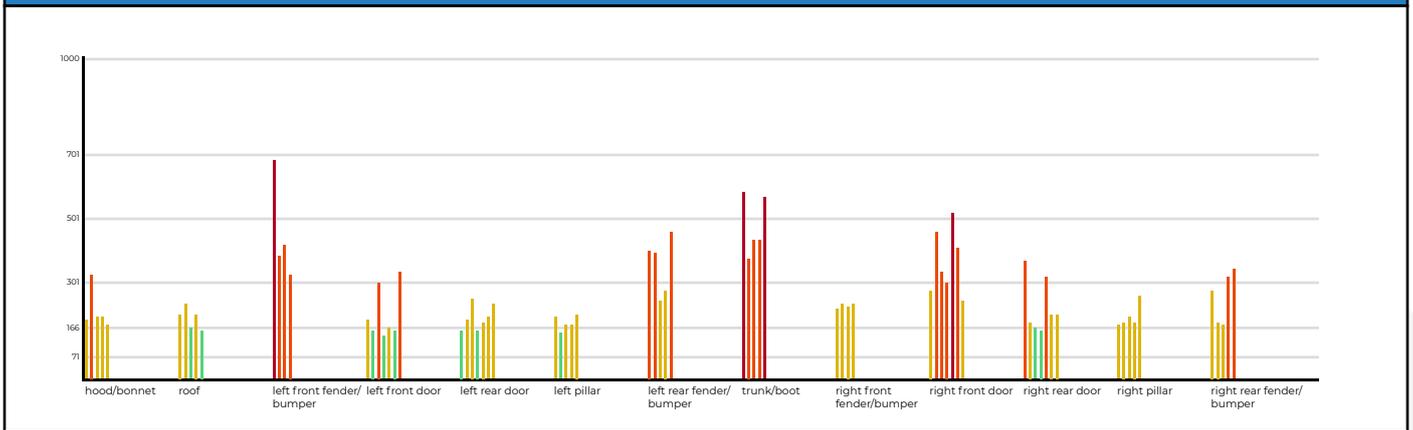

SYMMETRIC MEASUREMENTS

EXTERNAL MEASUREMENTS														
left front fender/ bumper	1. 687	2. 387	3. 422	4. 331	-	-	-	-	-	-	-	-	-	-
right front fender/ bumper	4. 240	3. 230	2. 234	1. 223	-	-	-	-	-	-	-	-	-	-
DIFFERENCE	447	157	188	108										
left front door	1. 189	2. 155	3. 308	4. 139	5. 166	6. 152	7. 336	-	-	-	-	-	-	-
right front door	7. 242	6. 409	5. 522	4. 306	3. 335	2. 465	1. 283	-	-	-	-	-	-	-
DIFFERENCE	53	254	214	167	169	313	53							
left rear door	1. 155	2. 188	3. 252	4. 155	5. 181	6. 199	7. 236	-	-	-	-	-	-	-
right rear door	7. 201	6. 208	5. 322	4. 151	3. 164	2. 183	1. 374	-	-	-	-	-	-	-
DIFFERENCE	46	20	70	4	17	16	138							
left pillar	1. 194	2. 142	3. 174	4. 171	5. 202	-	-	-	-	-	-	-	-	-
right pillar	5. 261	4. 175	3. 198	2. 177	1. 172	-	-	-	-	-	-	-	-	-
DIFFERENCE	67	33	24	6	30									
left rear fender/ bumper	1. 408	2. 393	3. 242	4. 283	5. 464	-	-	-	-	-	-	-	-	-
right rear fender/ bumper	5. 342	4. 322	3. 173	2. 176	1. 277	-	-	-	-	-	-	-	-	-
DIFFERENCE	66	71	69	107	187									

PHOTOS

