

REPORT

GENERAL INFORMATION

Report Name

Bmw

Read out date

2025-03-13 10:20:36

Date of editing

2025-03-13 11:08:53

Serial number

10373 PROFESSIONAL

Unit of measure

µm


VEHICLE DATA

Type	ESTATE
Make	Bmw
Model	3 series
Engine capacity [ccm]	1995
Power [kW]	140
VIN	WBA6L51010FH80696
Fuel Type	Diesel
Year of production	2019


MEASUREMENTS

"-" means measurement skip, "∞" means measurement out of range


PAS: general interpretation, body

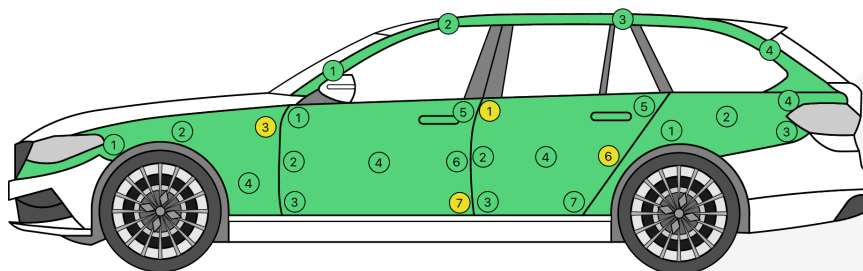


LEFT SIDE											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
left front fender/ bumper	Al	53	99	81	99	92	53	80	-	-	-
left front door	Fe+Zn	68	102	90	97	94	100	102	96	74	68
left rear door	Fe+Zn	60	97	82	60	97	90	86	85	68	90
left pillar	Fe+Zn	98	147	118	112	98	147	113	-	-	-
left rear fender/ bumper	Fe+Zn	86	107	97	107	94	100	86	-	-	-

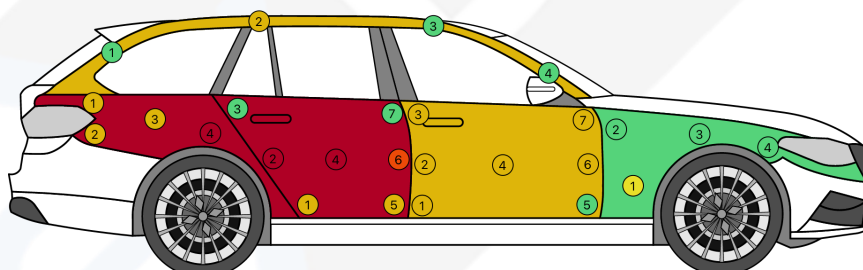

RIGHT SIDE											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
right front fender/ bumper	Al	70	96	84	70	79	90	96	-	-	-
right front door	Fe+Zn	164	285	199	170	285	198	196	164	191	188
right rear door	Fe	152	1394	571	258	1394	152	1327	213	495	157
right pillar	Fe	136	167	155	164	167	136	154	-	-	-
right rear fender/ bumper	Fe+Zn	225	654	352	254	276	225	654	-	-	-

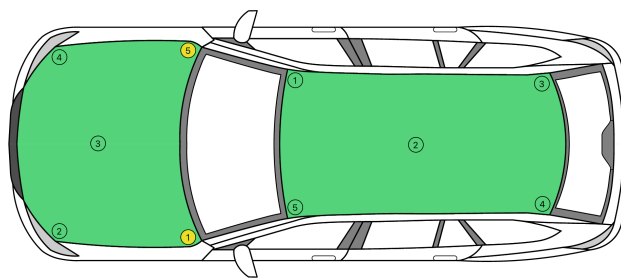


TOP											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
hood/bonnet	Al	56	98	74	69	74	74	98	56	-	-
roof	Fe+Zn	75	111	97	99	75	103	111	96	-	-

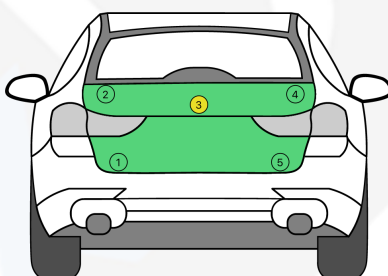

BACK											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
trunk/boot	Fe+Zn	62	91	78	76	78	62	83	91	-	-

Legend

- Disabled
- Paint layer is too thin
- Paint layer is original
- Second layer of paint
- A thin layer of putty
- A thick layer of putty

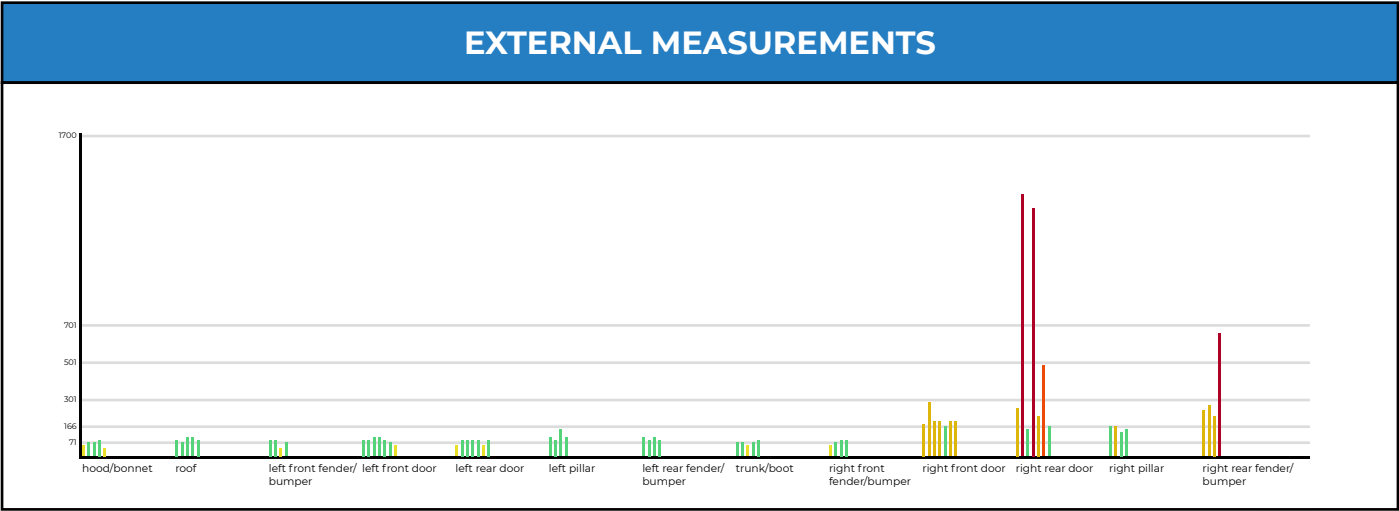

SYMMETRIC MEASUREMENTS

EXTERNAL MEASUREMENTS														
left front fender/ bumper	1. 99	2. 92	3. 53	4. 80	-	-	-	-	-	-	-	-	-	-
right front fender/ bumper	4. 96	3. 90	2. 79	1. 70	-	-	-	-	-	-	-	-	-	-
DIFFERENCE	3	2	26	10										
left front door	1. 97	2. 94	3. 100	4. 102	5. 96	6. 74	7. 68	-	-	-	-	-	-	-
right front door	7. 188	6. 191	5. 164	4. 196	3. 198	2. 285	1. 170	-	-	-	-	-	-	-
DIFFERENCE	91	97	64	94	102	211	102							
left rear door	1. 60	2. 97	3. 90	4. 86	5. 85	6. 68	7. 90	-	-	-	-	-	-	-
right rear door	7. 157	6. 495	5. 213	4. 1327	3. 152	2. 1394	1. 258	-	-	-	-	-	-	-
DIFFERENCE	97	398	123	1241	67	1326	168							
left pillar	1. 112	2. 98	3. 147	4. 113	-	-	-	-	-	-	-	-	-	-
right pillar	4. 154	3. 136	2. 167	1. 164	-	-	-	-	-	-	-	-	-	-
DIFFERENCE	42	38	20	51										
left rear fender/ bumper	1. 107	2. 94	3. 100	4. 86	-	-	-	-	-	-	-	-	-	-
right rear fender/ bumper	4. 654	3. 225	2. 276	1. 254	-	-	-	-	-	-	-	-	-	-
DIFFERENCE	547	131	176	168										