

REPORT

GENERAL INFORMATION

Report Name

Mini Countryman

Read out date

2025-07-14 13:41:22

Date of editing

2025-07-14 13:41:22

Serial number

10373 PROFESSIONAL

Unit of measure

µm

VEHICLE DATA

Type	HATCHBACK 5D
Make	Mini
Model	Countryman
Engine capacity [ccm]	-
Power [kW]	-
VIN	-
Fuel Type	-
Year of production	-


COMMENT

-


MEASUREMENTS

"-" means measurement skip, "∞" means measurement out of range


PAS: general interpretation, body

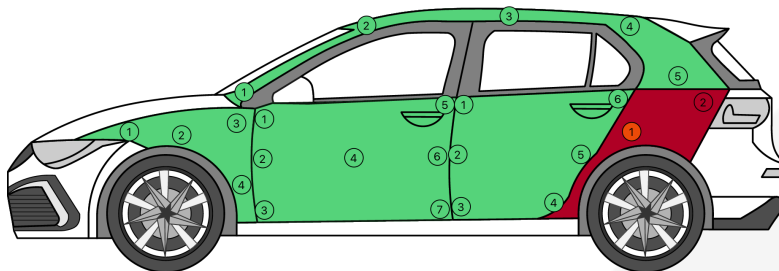


LEFT SIDE											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
left front fender/ bumper	Fe	75	96	84	96	88	76	75	-	-	-
left front door	Fe+Zn	71	111	86	77	111	98	83	71	89	75
left rear door	Fe	115	165	146	149	162	115	136	149	165	-
left pillar	Fe	113	160	134	160	142	125	113	130	-	-
left rear fender/ bumper	Fe+Zn	313	570	442	313	570	-	-	-	-	-

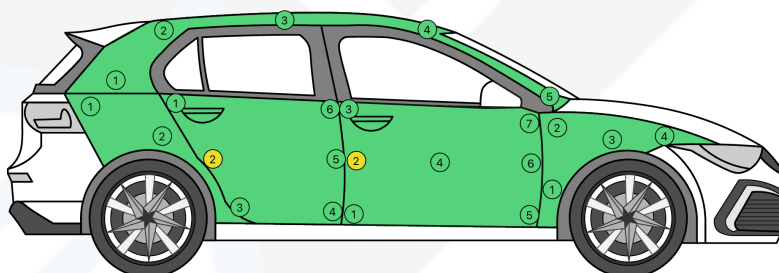

RIGHT SIDE											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
right front fender/ bumper	Fe	85	121	100	100	85	92	121	-	-	-
right front door	Fe+Zn	52	111	83	76	52	79	111	83	91	91
right rear door	Fe+Zn	61	160	92	88	61	79	82	84	160	-
right pillar	Fe	126	145	133	136	126	131	145	128	-	-
right rear fender/ bumper	Fe	75	92	84	75	92	-	-	-	-	-

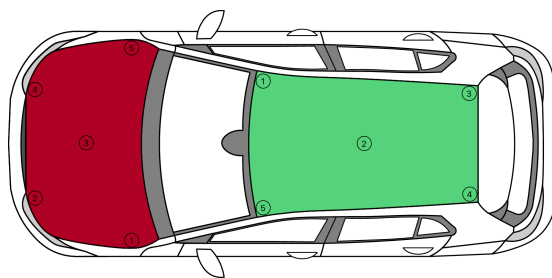


TOP											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
hood/bonnet	Fe+Zn	530	677	621	530	645	661	592	677	-	-
roof	Fe	127	148	135	129	148	132	139	127	-	-

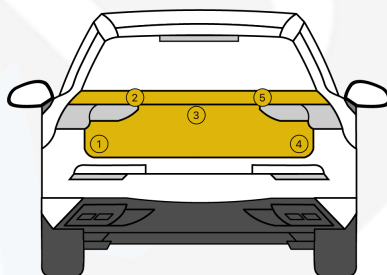

BACK											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
trunk/boot	Fe+Zn	175	252	223	231	233	224	252	175	-	-

Legend

- Disabled
- Paint layer is too thin
- Paint layer is original
- Second layer of paint
- A thin layer of putty
- A thick layer of putty

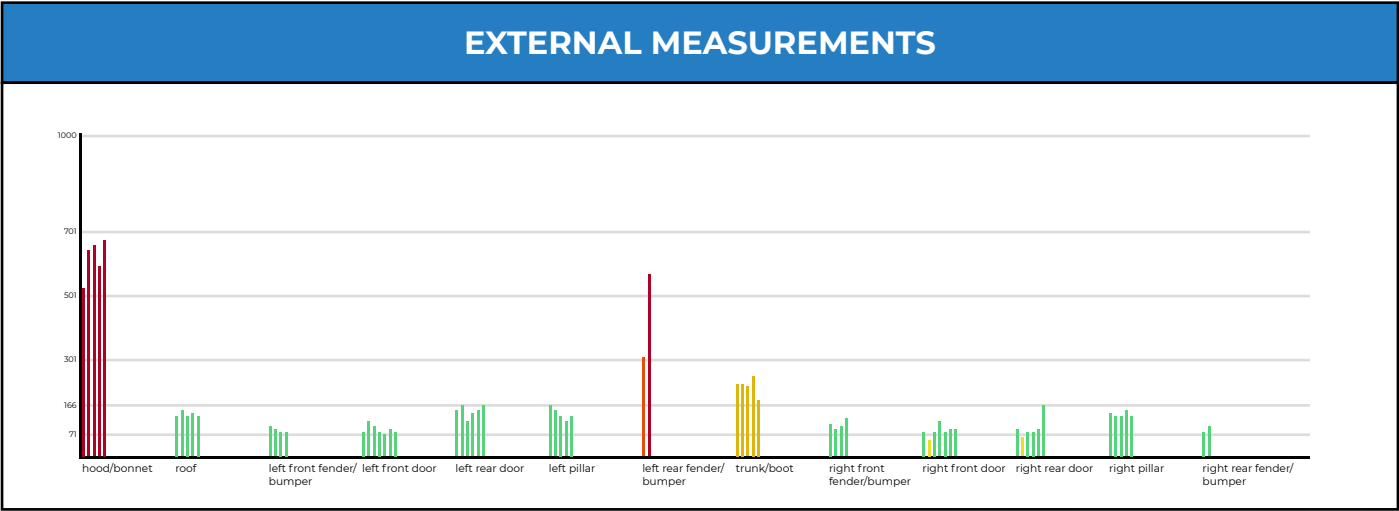

SYMMETRIC MEASUREMENTS

EXTERNAL MEASUREMENTS														
left front fender/ bumper	1. 96	2. 88	3. 76	4. 75	-	-	-	-	-	-	-	-	-	-
right front fender/ bumper	4. 121	3. 92	2. 85	1. 100	-	-	-	-	-	-	-	-	-	-
DIFFERENCE	25	4	9	25										
left front door	1. 77	2. 111	3. 98	4. 83	5. 71	6. 89	7. 75	-	-	-	-	-	-	-
right front door	7. 91	6. 91	5. 83	4. 111	3. 79	2. 52	1. 76	-	-	-	-	-	-	-
DIFFERENCE	14	20	15	28	8	37	1							
left rear door	1. 149	2. 162	3. 115	4. 136	5. 149	6. 165	-	-	-	-	-	-	-	-
right rear door	6. 160	5. 84	4. 82	3. 79	2. 61	1. 88	-	-	-	-	-	-	-	-
DIFFERENCE	11	78	33	57	88	77								
left pillar	1. 160	2. 142	3. 125	4. 113	5. 130	-	-	-	-	-	-	-	-	-
right pillar	5. 128	4. 145	3. 131	2. 126	1. 136	-	-	-	-	-	-	-	-	-
DIFFERENCE	32	3	6	13	6									
left rear fender/ bumper	1. 313	2. 570	-	-	-	-	-	-	-	-	-	-	-	-
right rear fender/ bumper	2. 92	1. 75	-	-	-	-	-	-	-	-	-	-	-	-
DIFFERENCE	221	495												