

REPORT

GENERAL INFORMATION

Report Name

Opel insignia

Read out date

2025-06-07 13:00:35

Date of editing

2025-06-09 15:34:43

Serial number

10373 PROFESSIONAL

Unit of measure

µm


VEHICLE DATA

Type	ESTATE
Make	Opel
Model	Insignia
Engine capacity [ccm]	1956
Power [kW]	103
VIN	W0LGM8ES0E1191477
Fuel Type	Diesel
Year of production	2014


MEASUREMENTS

"-" means measurement skip, "∞" means measurement out of range


PAS: general interpretation, body

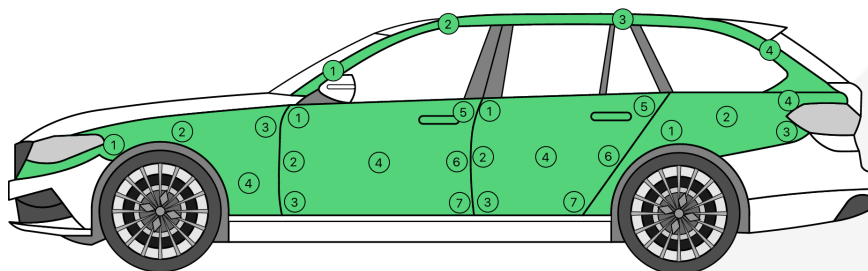


LEFT SIDE											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
left front fender/ bumper	Fe+Zn	85	134	109	85	106	111	134	-	-	-
left front door	Fe+Zn	109	151	130	140	129	113	151	137	134	109
left rear door	Fe	87	127	110	120	125	103	127	105	100	87
left pillar	Fe	87	108	96	93	96	108	87	-	-	-
left rear fender/ bumper	Fe+Zn	111	155	123	114	111	111	155	-	-	-

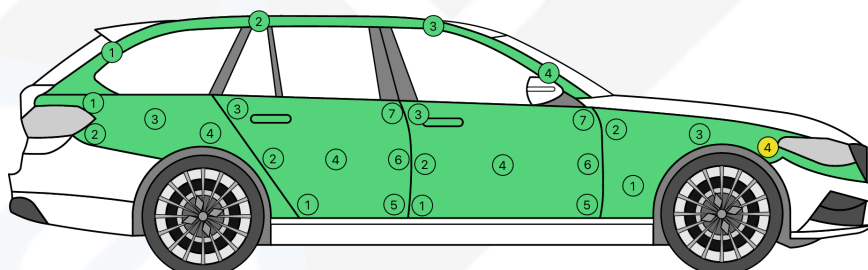

RIGHT SIDE											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
right front fender/ bumper	Fe+Zn	63	116	96	89	115	116	63	-	-	-
right front door	Fe+Zn	123	157	139	123	139	138	157	124	149	146
right rear door	Fe	88	133	109	88	93	123	112	109	102	133
right pillar	Fe+Zn	75	129	90	77	75	81	129	-	-	-
right rear fender/ bumper	Fe	104	124	118	104	124	120	122	-	-	-

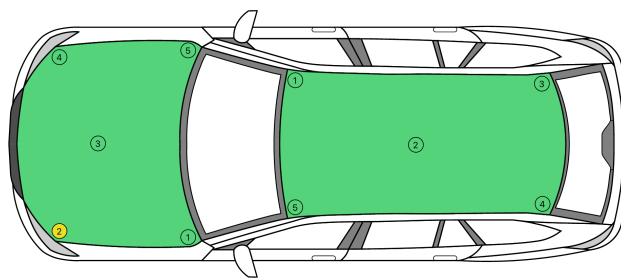


TOP											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
hood/bonnet	Al	57	114	96	114	57	112	92	104	-	-
roof	Fe	108	140	123	108	119	126	120	140	-	-

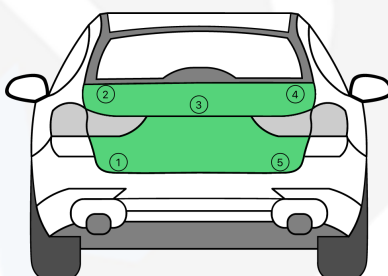

BACK											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
trunk/boot	Fe+Zn	126	132	129	130	132	126	130	129	-	-

Legend

- Disabled
- Paint layer is too thin
- Paint layer is original
- Second layer of paint
- A thin layer of putty
- A thick layer of putty

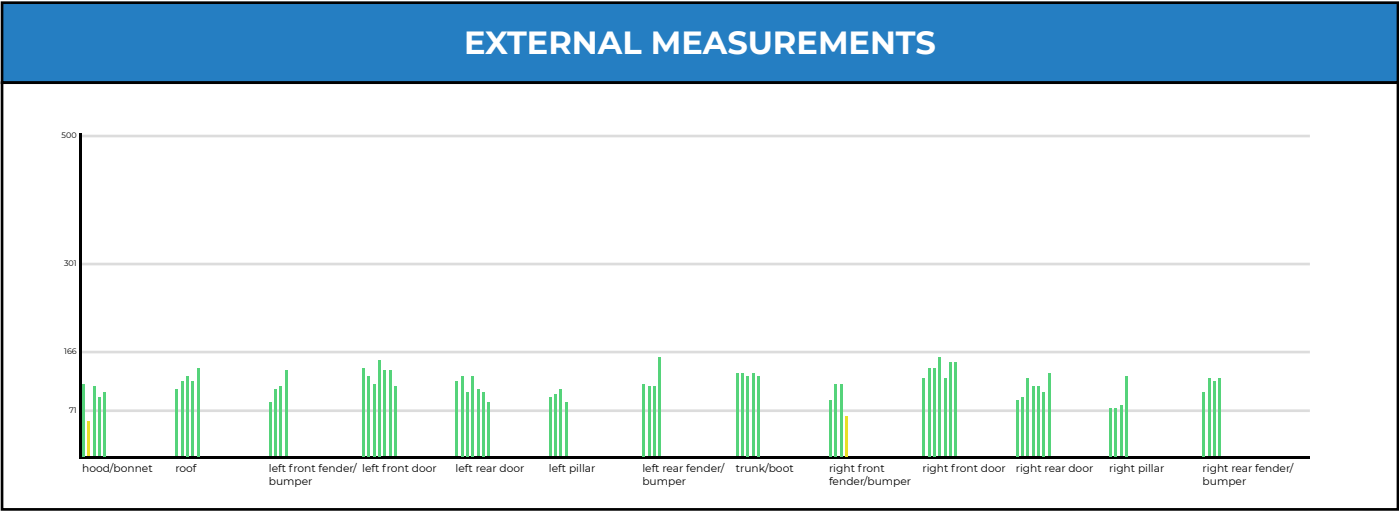

SYMMETRIC MEASUREMENTS

EXTERNAL MEASUREMENTS														
left front fender/ bumper	1. 85	2. 106	3. 111	4. 134	-	-	-	-	-	-	-	-	-	-
right front fender/ bumper	4. 63	3. 116	2. 115	1. 89	-	-	-	-	-	-	-	-	-	-
DIFFERENCE	22	10	4	45										
left front door	1. 140	2. 129	3. 113	4. 151	5. 137	6. 134	7. 109	-	-	-	-	-	-	-
right front door	7. 146	6. 149	5. 124	4. 157	3. 138	2. 139	1. 123	-	-	-	-	-	-	-
DIFFERENCE	6	20	11	6	1	5	14							
left rear door	1. 120	2. 125	3. 103	4. 127	5. 105	6. 100	7. 87	-	-	-	-	-	-	-
right rear door	7. 133	6. 102	5. 109	4. 112	3. 123	2. 93	1. 88	-	-	-	-	-	-	-
DIFFERENCE	13	23	6	15	18	7	1							
left pillar	1. 93	2. 96	3. 108	4. 87	-	-	-	-	-	-	-	-	-	-
right pillar	4. 129	3. 81	2. 75	1. 77	-	-	-	-	-	-	-	-	-	-
DIFFERENCE	36	15	33	10										
left rear fender/ bumper	1. 114	2. 111	3. 111	4. 155	-	-	-	-	-	-	-	-	-	-
right rear fender/ bumper	4. 122	3. 120	2. 124	1. 104	-	-	-	-	-	-	-	-	-	-
DIFFERENCE	8	9	13	51										