

REPORT

GENERAL INFORMATION

Report Name

Golf 5

Read out date

2025-05-05 09:49:49

Date of editing

2025-05-05 12:04:55

Serial number

10373 PROFESSIONAL

Unit of measure

µm


VEHICLE DATA

Type	HATCHBACK 5D
Make	Golf
Model	5
Engine capacity [ccm]	1390
Power [kW]	90
VIN	WVWZZZ1KZ9W567446
Fuel Type	Gas
Year of production	2009


MEASUREMENTS

"-" means measurement skip, "∞" means measurement out of range


PAS: general interpretation, body

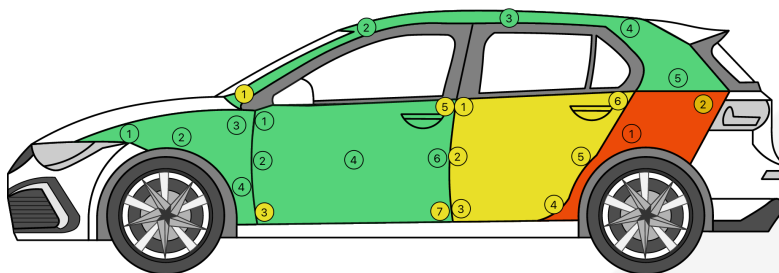


LEFT SIDE											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
left front fender/ bumper	Fe+Zn	71	89	79	75	80	89	71	-	-	-
left front door	Fe+Zn	54	89	71	78	80	54	89	60	71	64
left rear door	Fe+Zn	52	70	60	64	70	53	59	64	52	-
left pillar	Fe+Zn	65	153	103	65	81	71	147	153	-	-
left rear fender/ bumper	Fe+Zn	187	459	323	459	187	-	-	-	-	-

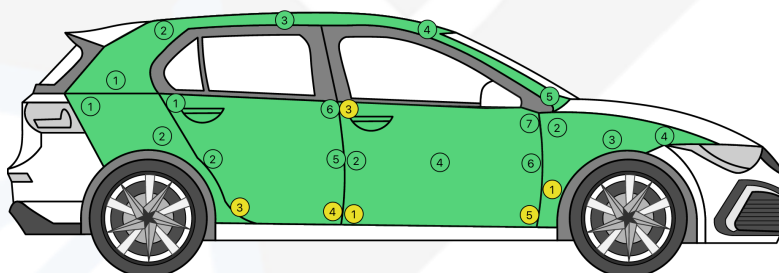

RIGHT SIDE											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
right front fender/ bumper	Fe+Zn	60	117	93	60	95	117	100	-	-	-
right front door	Fe	63	102	82	68	87	64	102	63	92	96
right rear door	Fe	67	96	79	96	80	70	67	86	74	-
right pillar	Fe+Zn	75	108	92	108	96	91	75	90	-	-
right rear fender/ bumper	Fe	84	112	98	112	84	-	-	-	-	-

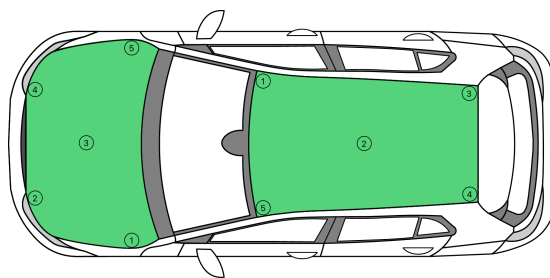


TOP											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
hood/bonnet	Fe	71	109	99	100	109	105	71	109	-	-
roof	Fe+Zn	91	135	109	94	91	135	122	102	-	-

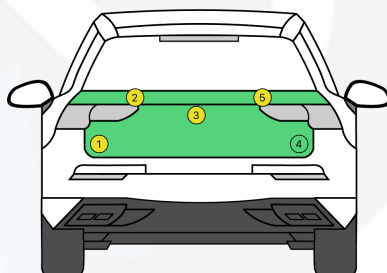

BACK											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
trunk/boot	Fe+Zn	53	161	77	53	55	60	161	57	-	-

Legend

- Disabled
- Paint layer is too thin
- Paint layer is original
- Second layer of paint
- A thin layer of putty
- A thick layer of putty

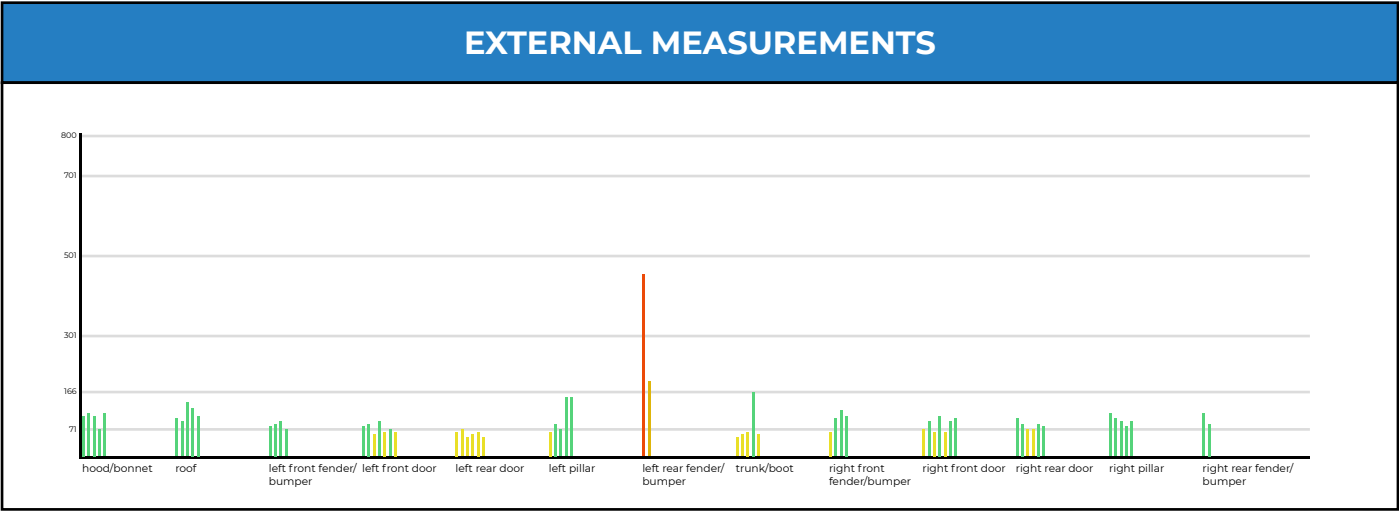

SYMMETRIC MEASUREMENTS

EXTERNAL MEASUREMENTS														
left front fender/ bumper	1. 75	2. 80	3. 89	4. 71	-	-	-	-	-	-	-	-	-	-
right front fender/ bumper	4. 100	3. 117	2. 95	1. 60	-	-	-	-	-	-	-	-	-	-
DIFFERENCE	25	37	6	11										
left front door	1. 78	2. 80	3. 54	4. 89	5. 60	6. 71	7. 64	-	-	-	-	-	-	-
right front door	7. 96	6. 92	5. 63	4. 102	3. 64	2. 87	1. 68	-	-	-	-	-	-	-
DIFFERENCE	18	12	9	13	4	16	4							
left rear door	1. 64	2. 70	3. 53	4. 59	5. 64	6. 52	-	-	-	-	-	-	-	-
right rear door	6. 74	5. 86	4. 67	3. 70	2. 80	1. 96	-	-	-	-	-	-	-	-
DIFFERENCE	10	16	14	11	16	44								
left pillar	1. 65	2. 81	3. 71	4. 147	5. 153	-	-	-	-	-	-	-	-	-
right pillar	5. 90	4. 75	3. 91	2. 96	1. 108	-	-	-	-	-	-	-	-	-
DIFFERENCE	25	6	20	51	45									
left rear fender/ bumper	1. 459	2. 187	-	-	-	-	-	-	-	-	-	-	-	-
right rear fender/ bumper	2. 84	1. 112	-	-	-	-	-	-	-	-	-	-	-	-
DIFFERENCE	375	75												